

# Accessories for tool types T2600, V600, V611 and PVL611

- Note that KRF terminals may be used on flexible (IEC60228, class 5) as well as stranded (class 2) conductors and that KR D and KRT terminals are used on stranded conductors.
- Be sure to use dies exactly matching the terminal.

## Crimp dies


Supplied as a pair. For hexagonal crimping of Cu terminals and connectors. Note: KB dies are for V600, V611 and PVL611 only.




TB dies.



KB dies.

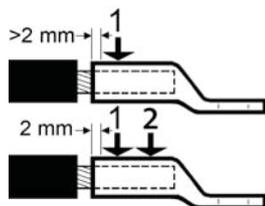

One and two crimps.



Three crimps.

KRF/KSF		
mm <sup>2</sup>	Dies	No. of crimps
10 and 70	TB8-17	1 resp.2
16 and 35	TB9-13	1
25 and 50	TB11-14,5	1
10 and 95	TB7 <sup>1</sup> -20	1 resp.2
120	KB22	3
150	KB25	3

<sup>1</sup> TB7 special for crimping KRX-terminals and KSX-connectors

<sup>2</sup> For terminals type KR10 and connectors type KS10

KRD/KSD		
mm <sup>2</sup>	Dies	No. of crimps
10 <sup>2</sup> /16 and 70	TB8-14	1
25 and 50	TB9-12	1
35 and 95	TB11-16	1 resp.2
10 <sup>1</sup> and 120	TB7 <sup>1</sup> -19	1 resp.2
150	KB22	3
185	KB25	3

<sup>1</sup> TB7 special for crimping KRX-terminals and KSX-connectors

<sup>2</sup> For terminals type KR10 and connectors type KS10

KRT/KST		
mm <sup>2</sup>	Dies	No. of crimps
10 <sup>1</sup> and 120	TB7-19	1 resp.2
10 <sup>2</sup> and 95	TB8-18	1 resp.2
16 and 95	TB8,5-18	1 resp.2
25 and 70	TB10-16	1 resp.2
35 and 50	TB12-14	1
150	KB22	3
185	KB24	3
240	KB26	3

<sup>1</sup> TB7 is also for crimping KRX-terminals and KSX-connectors

<sup>2</sup> For terminals type KR10 and connectors type KS10

DIN 46235		
mm <sup>2</sup>	Dies	No. of crimps
10-16	TB6-8DIN	1
25-35	TB10-12DIN	1
50-70	TB14-16DIN	1 resp.2
95	TB18DIN	1 resp.2